


10-1-44  
 Rev: MS1127

TAPE TO B.S. SPEC. 419  
TO OVERLAP CLIP.

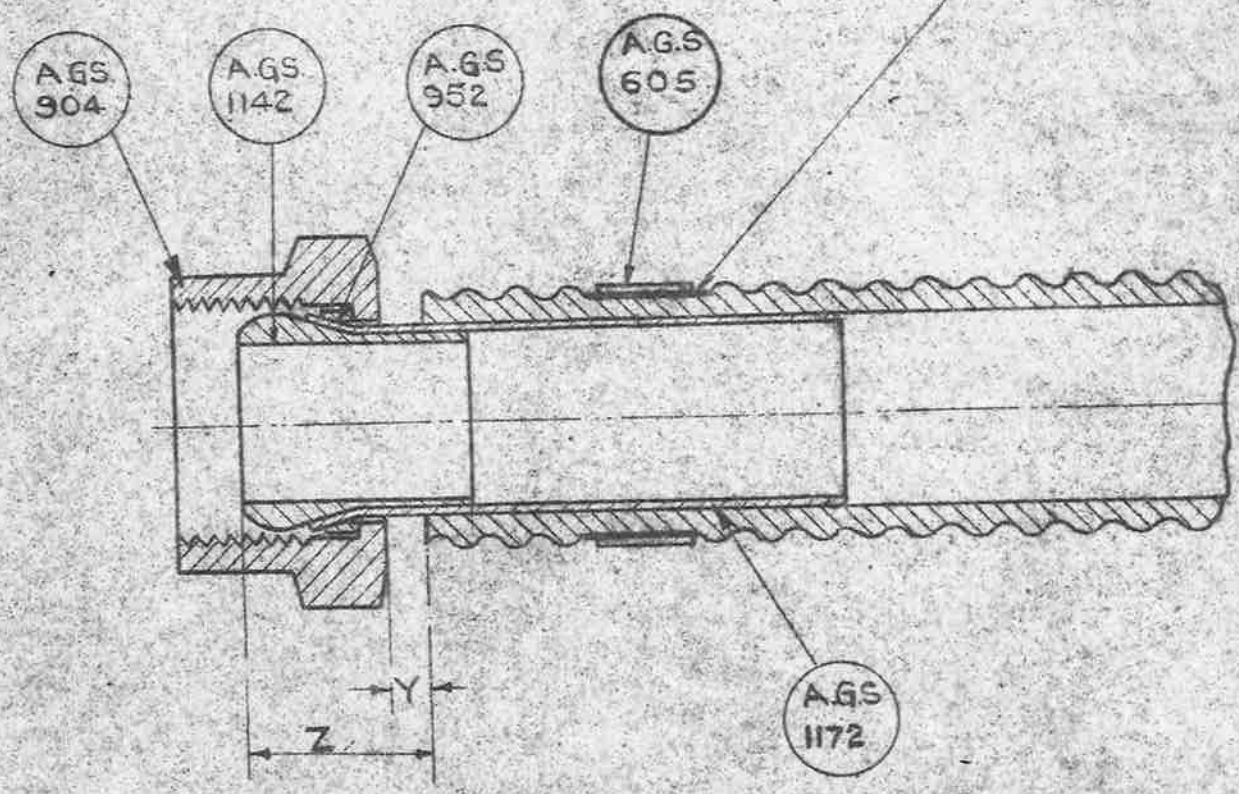

BORE OF FLEXATEX HOSE	OUTERSLEEVE AGS 904. MARK	COLLAR AGS 952 MARK	CLIP AGS 605 MARK	TUBE AGS 1172 MARK	DIMENSION		NIPPLE AGS 1142 MARK
					Y (MAX)	Z (APPROX)	
1/4"	B	B	0	B	.15"	5/64"	B
3/8"	C	C	0	C	.15"	13/16"	C
1/2"	D	D	1	D	.15"	27/32"	D
5/8"	E	E	1	E	.20"	15/16"	E
3/4"	F	F	1	F	.20"	61/64"	F
7/8"	G	G	1	G	.20"	31/32"	G
1"	H	H	1	H	.25"	1 1/32"	H
1 1/4"	J	J	2	J	.25"	1 3/32"	J
1 1/2"	K	K	2	K	.25"	1 5/32"	K

REQUIRED TO COMPLETE CONNECTION TO FEMALE

**NOTES:-** DIMENSION Z IS GIVEN FOR INFORMATION ONLY TO ENABLE ACTUAL LENGTH OF FLEXATEX HOSE REQUIRED TO BE ASCERTAINED.  
 HOSE IS TO BE FITTED TO TUBE IN ACCORDANCE WITH S.I.S No 57 (LATEST ISSUE.)

ISSUED BY THE ROYAL AIRCRAFT ESTABLISHMENT.	TITLE:- FLARED END CONNECTION (STRAIGHT) FOR FLEXATEX FUEL HOSE GENERAL ARRANGEMENT.		DRAWN C.T. Reynolds.	TRACED B.E.W.
	ISSUE NO 1	2	CHECKED FROM S.A.E. DR. [Signature]	APPROVE [Signature]
	ALTERATION NO	MOD NO AGS 507	AGS 329	